

THERMOLAST® K

The FC/CS Series is your material solution for applications with food contact providing an excellent compression set. The series is available in translucent colors.

Typical applications

- Closures
- Flexible Connections
- Household articles
- Membranes
- · Packaging (for food and careproducts)
- Seals
- Valves

Material advantages

- · Adhesion to PP
- · Applications with food contact
- · Easy coloring
- EN71/3
- · Excellent mechanical properties
- FDA Code of Federal Regulations (CFR), Title 21
- For injection molding and extrusion
- High elasticity
- · Perfect surface finish
- Recyclable
- Regulation (EU) No 10/2011

Processing Method: Extrusion, Injection Molding

	Color / RAL DESIGN	Hardness DIN ISO 7619-1 ShoreA	Density DIN EN ISO 1183-1 g/cm3	Tensile Strength ¹ DIN 53504/ISO 37 MPa	Elongation at Break ¹ DIN 53504/ISO 37 %	Tear Resistance ISO 34-1 Methode B (b)(Graves) N/mm	CS 72 h/23 °C DIN ISO 815-1 Method A %	CS 24 h/70 °C DIN ISO 815-1 Method A %	CS 24 h/100 °C DIN ISO 815-1 Method A %
TF3STE	translucent	33	0.890	7.0	800	10.5	15	26	42
TF4STE	translucent	44	0.890	9.0	850	13.5	20	30	45
TF5STE	translucent	54	0.890	11.0	850	17.0	23	38	48
TF6STE	translucent	65	0.890	12.5	800	21.5	27	40	53
TF7STE	translucent	75	0.890	13.0	750	27.5	35	50	60
TF8STE	translucent	83	0.890	14.5	700	35.0	44	66	75

¹ Deviating from ISO 37 standard test piece S2 is tested with a traverse speed of 200 mm/min.

All values published in this data sheet are rounded average values.








THERMOLAST® K

Compression Set

Compression Set (acc. DIN ISO 815)

For the compression set testing the following specimen is used: The specimen is a cylindrical disk shaped 6 mm thick and 13 mm in diameter.

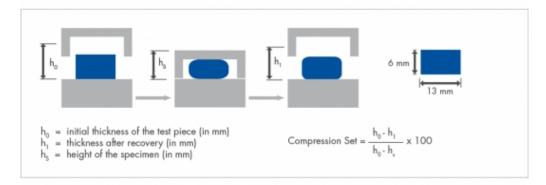

The specimen is compressed by 25%. The compressed specimen is heated to the test temperature. DIN ISO 815 discribes two methods.

Method A: The specimen is allowed to recover immediately after its aging in the oven and then cooled down to room temperature. After 30 minutes the thickness of the specimen is measured and the compression set calculated.

Method B: The specimen is cooled down to room temperature after its aging in the oven and then allowed to recover.

Test results gained from method B are in general higher than from method A.







THERMOLAST® K

Processing Guideline Injection Molding						
Cylinder temperature	180 - 200 - 220 °C, max. 250 °C (360 - 390 - 430 °F, max. 480 °F)					
Hotrunner	Hot runner temperatures: 200 -250 °C (390 - 480 °F). The runner should be empty after a maximum o 2 - 3 shots.					
Injection pressure	200 - 1000 bar (2900 - 14504 psi) (depending on the size and weight of the part).					
Injection rate	In general, the fill time should not be more than 1–2 seconds.					
Hold pressure	We recommend to derive the optimum hold pressure from determining the solidification point, starting with 40 % - 60 % of the required injection pressure.					
Back pressure	20 - 100 bar; if color batches are used, higher back pressure is necessary.					
Screw retraction	If an open nozzle is used processing with screw retraction is advisable.					
Mold temperature	25 - 40 °C (77 - 104 °F)					
Predrying	Pre drying of the material is not necessary; if surface moisture forms as a result of changes in temperature, the material should be dried for 2 - 4 hours at 60 - 80 °C (140 - 175 °F).					
Needle valve	With materials < 50 Shore A the use of a needle valve is advisable.					
Screw geometry	Standard 3-zone polyolefine screw.					
Residence time	The residence time is to be set as short as possible with a maximum of 10 minutes.					
Cleaning recommendation	For cleaning and purging of the machine it is appropriate to use polypropylene or polyethylene. Machine must be PVC-free.					









THERMOLAST® K

Processing Guideline Extrusion						
Cylinder temperature	160 - 180 - 200 °C, max. 250 °C (320 - 360 - 390 °F; max. 480 °F)					
Screw geometry	Standard three-zone screw (e.g. polyolefin screw). The screw must be able to provide sufficient shearing.					
L/D ratio	At least 25					
Compression ratio	At least 3.5 : 1					
Screens / breaker plate	A breaker plate and a screen pack are generally recommended in the extruder configuration in order increase pressure.					
Die land	<= 3 mm (<= 0,12 in.)					
Extruder Head	Ca. 200 °C (390 °F)					
Die temperature	Ca. 200 - 230 °C (390 - 450 °F)					
Predrying	Pre drying of the material is not necessary; if surface moisture forms as a result of changes in temperature, the material should be dried for 2 - 4 hours at 60 - 80 °C (140 - 175 °F).					
Calibration	Generally not necessary; support elements may be required when extruding THERMOLAST® compounds with high hardness or when coextruding with standard thermoplastics.					
Cleaning recommendation	For cleaning and purging of the machine it is appropriate to use polypropylene or polyethylene. Machine must be PVC-free.					



